



SCOTT IS ADVISING ALL OWNERS OF AIR-PAK SCBA EQUIPPED WITH HEADS-UP DISPLAY OF THE AVAILABILITY OF A USER INSTALLABLE ANTI-ROTATION CLAMP.



## TECHNICAL BULLETIN


### TECHNICAL BULLETIN

TB: 20080805


**TO: Owners of SCOTT® SCBA Equipped with Heads-Up Display**  
**FROM: Rick Hofmeister**  
**SUBJECT: Addition of Anti-Rotation Clamp**  
**DATE: May 8, 2008**

SCOTT has determined through examination of warranty returns, that the electrical connection found on the low pressure hoses used on the Air-Pak® Fifty SCBA and 2.2/3.0/4.5 Air-Pak® SCBA equipped with a Heads-up Display (HUD) may wear prematurely under heavy use conditions. SCOTT Engineers have reviewed this condition and determined that repeated rotation of the regulator and low pressure hose at the HUD connection contributes to such premature wear of the electrical connector. As a result, SCOTT is releasing an Anti-Rotation Clamp which will eliminate the repeated twisting of the low pressure hose.

SCOTT is advising all owners of Air-Pak® SCBA equipped with Heads-Up Display of the availability of a user installable Anti-Rotation Clamp. The Anti-Rotation Clamp is available in two configurations dependent on the type of reducer outlet to low pressure hose connection found on the SCOTT Air-Pak® SCBA. The figures below show the two styles of outlets found on SCOTT SCBA and are labeled Single Outlet Reducer and Dual Outlet Reducer.

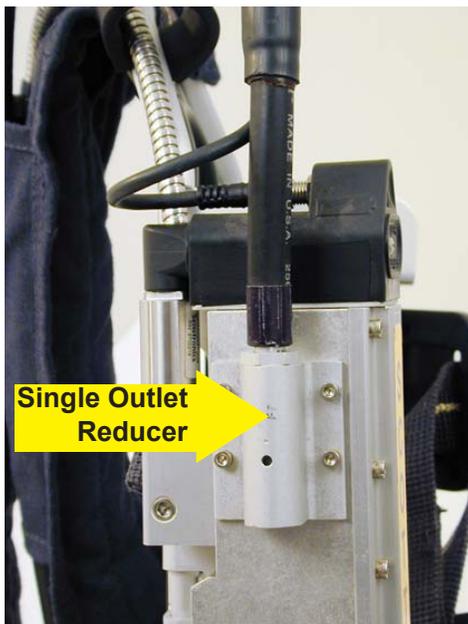


**FIGURE 1 – Single Outlet Pressure Reducer**

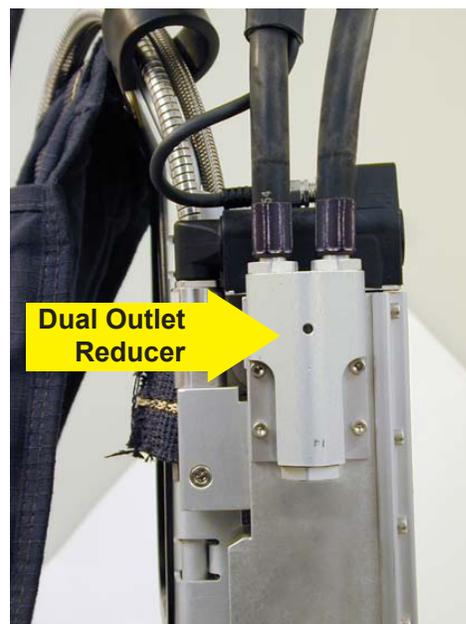


**FIGURE 2 – Dual Outlet Pressure Reducer**

Once the Anti-Rotation Clamp is installed, the movement of the low pressure hose at the electrical connection is limited eliminating stress from repeated twisting on this connection. Units that are equipped with the Anti-Rotation Clamp will appear as shown below:

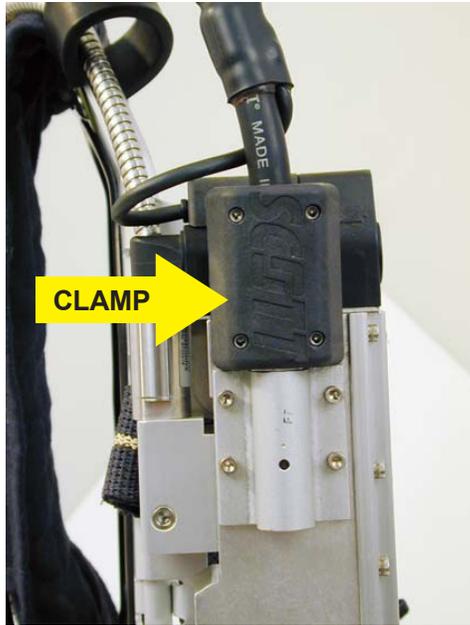

**FIGURE 3 – Single Outlet Reducer Hose Clamp, SCOTT P/N 200718-01**

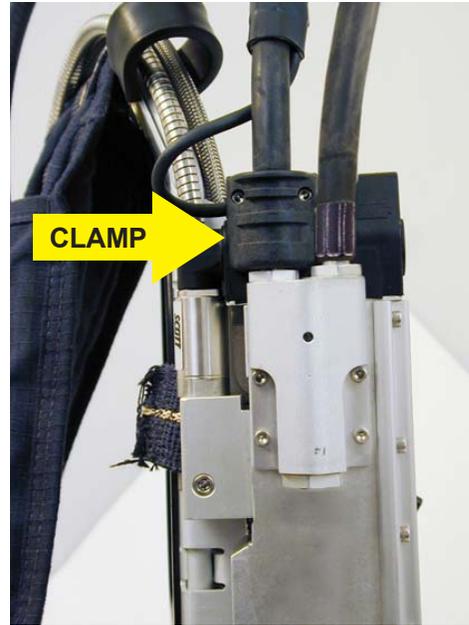

**FIGURE 4 – Dual Outlet Reducer Hose Clamp, SCOTT P/N 200718-02**

Through a special program, SCOTT is making the Anti-Rotation Clamp available at no charge for owners who have experienced premature wear at the electrical connection of the low pressure hose. To obtain quantities of the Anti-Rotation Clamps sufficient to outfit all your SCOTT SCBA, simply complete the attached Customer Claim Form and return it to SCOTT Health and Safety either via FAX or by mailing the completed form to the address listed. Anti-Rotation Clamps will be sent directly to your department.

SCOTT is committed to the safety and satisfaction of the people who use our products everyday. Should you have any questions concerning this program, please feel free to contact your SCOTT Regional Manager or Technical Support Team Member.



Health & Safety Products  
Monroe Corporate Center  
PO Box 569  
Monroe, NC 28111  
Telephone 1-800-247-7257  
FAX (704) 291-8330  
[www.scotthealthsafety.com](http://www.scotthealthsafety.com)

Copyright © 2008, SCOTT, All Rights Reserved



NYS Department of State  
**OFFICE OF  
FIRE PREVENTION  
& CONTROL**


**phone** 518.474.6746  
**fax** 518.474.3240  
**email** [fire@dos.state.ny.us](mailto:fire@dos.state.ny.us)

[WWW.DOS.STATE.NY.US/FIRE/FIREWWW.HTML](http://WWW.DOS.STATE.NY.US/FIRE/FIREWWW.HTML)


# SCOTT® ANTI-ROTATION CLAMP CLAIM FORM

You may claim your Anti-Rotation Clamps to outfit your SCOTT® AIR-PAK® SCBA equipped with Heads-Up Display by completing this form and returning it via FAX or mail to SCOTT Health & Safety. SEE TECHNICAL BULLETIN TB: 20090401 FOR COMPLETE INFORMATION.

Identify the type and quantity of SCOTT SCBA in your possession:

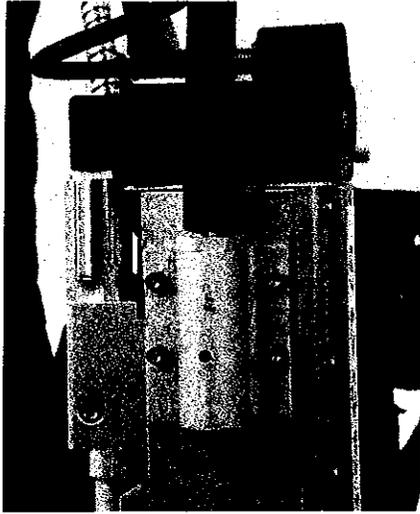

QTY \_\_\_\_\_ **Single Outlet  
Pressure Reducer**

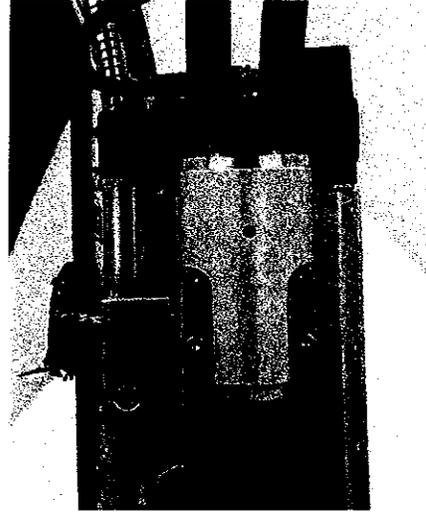

QTY \_\_\_\_\_ **Dual Outlet  
Pressure Reducer**

*Please type or print*

Company/Organization

Shipping Address (*Must Include Street Address NOT Post Office Box*)

City

State/Province

Zip/Postal Code

Company/Organization Contact name & Title

Telephone #

Fax #

E-mail Address

Authorized Signature

Date

For additional information concerning the Anti-Rotation Clamp program please contact SCOTT Technical Support at 1-800-247-7257 or through e-mail at [hsservice@tycoint.com](mailto:hsservice@tycoint.com) or your SCOTT Authorized Distributor or SCOTT Authorized Service Center.

Once you have completed this form, fax it to SCOTT at 1-704-291-8420 in the United States, or fold and seal as marked and place in U.S. Mail. Outside the United States please fold, seal, apply proper postage, and place in mail. Kits should arrive six to eight weeks after Scott receives your request. Photocopy as many copies of this form as you need.